

**SSM 50103 - 2020 Mustang - 5.0L Engine - Illuminated MIL With DTC P0369
- Built On 01-Sep-2020 And Through 01-Dec-2020**

Some 2020 Mustang vehicles equipped with a 5.0L engine built on 01-Sep-2020 and through 01-Dec-2020 may experience an illuminated malfunction indicator lamp (MIL) with diagnostic trouble code (DTC) P0369 in the powertrain control module (PCM). This may be due to a flatness concern on the mega cap on the right hand cylinder head. To correct the condition, replace the right-hand cylinder head. Refer to Workshop Manual (WSM), Section 303-01B > Removal and installation > Cylinder Head RH. For claiming, use causal part 6049 and applicable labor times in Section 06 of the Service Labor Time Standards (SLTS) Manual.

APPLICABLE VEHICLES
2020 CAR: ZG S550N MUSTANG